MAXON<sup>®</sup> LIFT CORPORATION Sht. 1 of 9 DSG# M-13-06 Rev. A Date: 03/10/14

### INSTRUCTIONS, FLASHING LIGHT INSTALLATION KIT KIT P/N 286755-01 (BMRSD WITH ALUMINUM FLIPOVER & FIXED RAMP)




LOCK WASHER, 1/4" P/N 902011-2 QTY. 4



FLASHING SAFETY LIGHT P/N 907150-01 QTY. 2 BUTTON SCREW, 1/4"-20 X 1-1/4" LG, STAINLESS STEEL P/N 900719-08 QTY. 4


#### KIT P/N 286751-01 (BMR-A WITH STEEL FLIPOVER & ALUMINUM RETENTION RAMP)

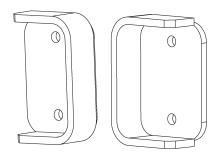

LIGHT SUPPORT BRACKET, STAINLESS STEEL P/N 288939-02 QTY. 2



BUTTON SCREW, 1/4"-20 X 1-1/4" LG, STAINLESS STEEL P/N 900719-08 QTY. 4

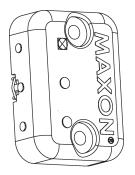



FLASHING SAFETY LIGHT P/N 907150-01 QTY. 2




LOCK NUT, 1/4"-20, NYLON P/N 901000 QTY. 4 **MAXON**<sup>®</sup> LIFT CORPORATION Sht. 2 of 9 DSG# M-13-06 Rev. A Date: 03/10/14

KIT P/N 287114-01 (BMR-A WITH STEEL FLIPOVER & FIXED RAMP)

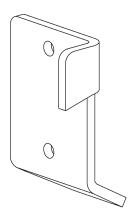

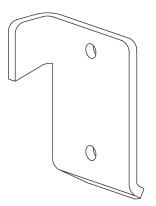

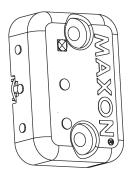

LH LIGHT BRACKET, STAINLESS STEEL P/N 287462-12 QTY. 1


RH LIGHT BRACKET, STAINLESS STEEL P/N 287462-11 QTY. 1

FLASHING SAFETY LIGHT P/N 907150-01 QTY. 2

BUTTON SCREW, 1/4"-20 X 1-1/4" LG, STAINLESS STEEL P/N 900719-08 QTY. 4

LOCK NUT, 1/4"-20, NYLON P/N 901000 QTY. 4 **MAXON**<sup>®</sup> LIFT CORPORATION Sht. 3 of 9 DSG# M-13-06 Rev. A Date: 03/10/14

KIT P/N 287126-01 (BMR-A WITH STEEL FLIPOVER & FIXED RAMP, SINGLE & DUAL CART STOPS)

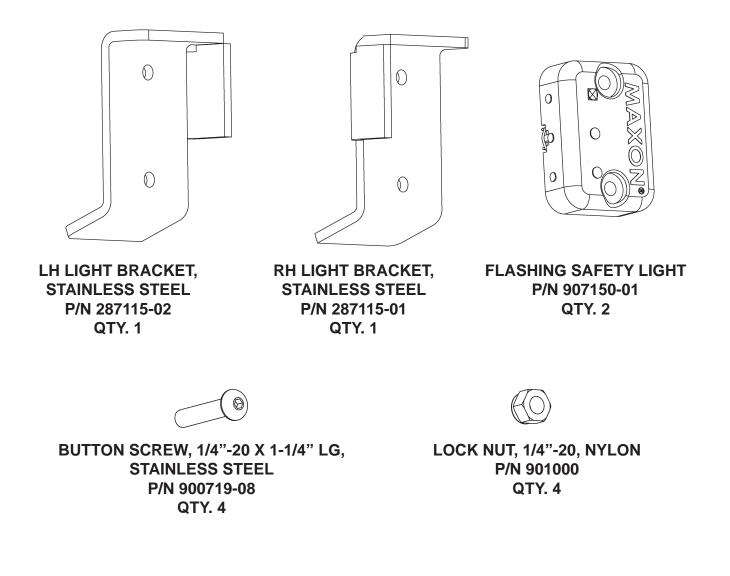


MAXON<sup>®</sup> LIFT CORPORATION Sht. 4 of 9 DSG# M-13-06 Rev. A Date: 03/10/14

#### PREPARE LIFTGATE

### A WARNING

Use jack stands to support platform while performing this procedure.

 Unfold and lower platform about 18" off the ground. Refer to BMRA/BMRSD Operation Manual for instructions about operating Liftgate. Support platform and flipover with jack stands as shown in FIG. 4-1.

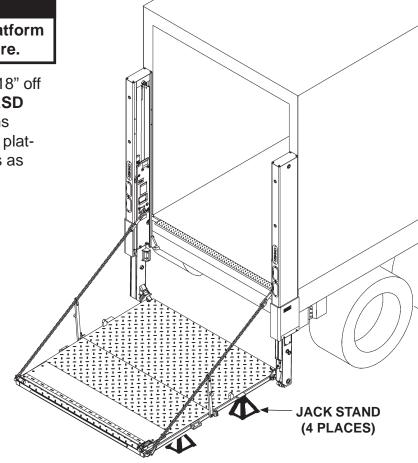


PLATFORM WITH RETENTION RAMP UNFOLDED & LOWERED ON JACK STANDS FIG. 4-1

# 

To prevent possible injury, ensure Liftgate cannot be operated while kit is being installed. Turn OFF master disconnect switch before installing the parts from kit.

2. Disconnect battery power from pump by turning OFF master disconnect switch (FIG. 4-2).

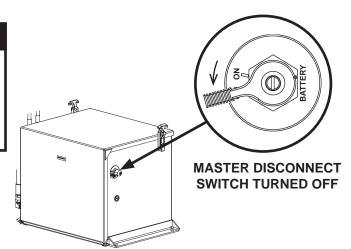


DISCONNECTING BATTERY POWER AT PUMP BOX FIG. 4-2

# MAXON<sup>®</sup> LIFT CORPORATION Sht. 5 of 9 DSG# M-13-06 Rev. A Date: 03/10/14

**NOTE:** The following are instructions for installing 4 different kits. Follow the instructions that apply to your kit and type of flipover.

#### KIT P/N 286755-01 (BMRSD WITH ALUMINUM FLIPOVER & FIXED RAMP)

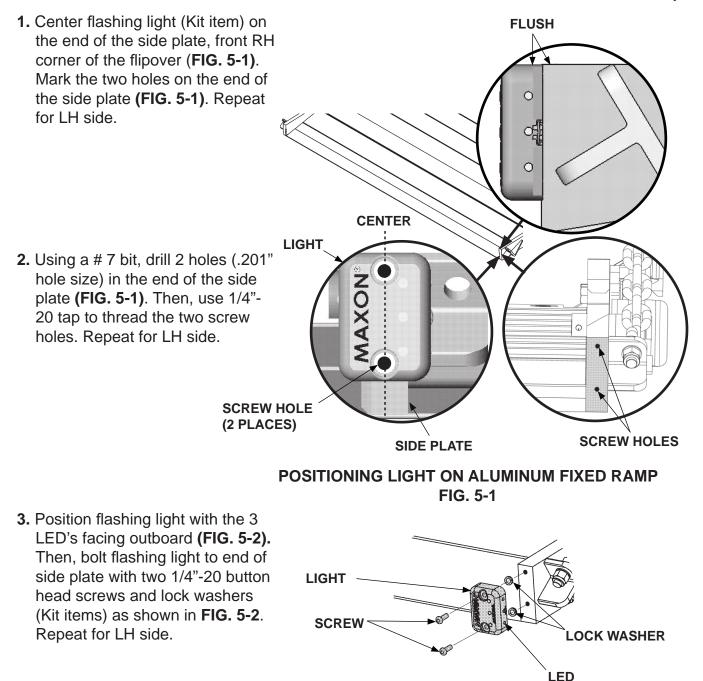

BOLTING LIGHT TO ALUMINUM FIXED RAMP FIG. 5-2

(3 PLACES)


# KIT P/N 286751-01 (BMR-A WITH STEEL FLIPOVER & ALUMINUM RETENTION RAMP)

### CAUTION

To protect the original paint system, a 3" wide area of paint must be removed from all sides of the weld area before welding.

# **WARNING**

Welding on galvanized parts gives off especially hazardous fumes. To minimize hazard remove galvanizing from weld area, provide adequate ventilation, and wear suitable respirator.

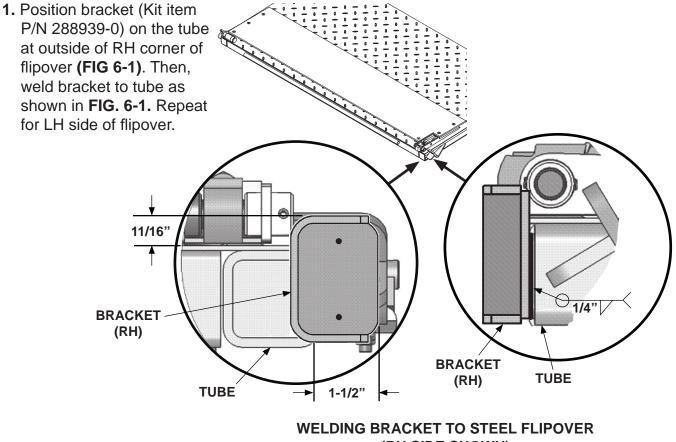

(RH SIDE SHOWN) FIG. 6-1

 Allow welds to cool. Then touch up the paint using aluminum primer touchup paint kit, P/N 908134-01 for painted platform. Use cold galvanized spray P/N 908000-01 for galvanized platforms.

# MAXON<sup>®</sup> LIFT CORPORATION Sht. 7 of 9 DSG# M-13-06 Rev. A Date: 03/10/14


#### KIT P/N 287114-01 (BMR-A WITH STEEL FLIPOVER & FIXED RAMP)

### CAUTION

To protect the original paint system, a 3" wide area of paint must be removed from all sides of the weld area before welding.

# **A**WARNING

Welding on galvanized parts gives off especially hazardous fumes. To minimize hazard remove galvanizing from weld area, provide adequate ventilation, and wear suitable respirator.

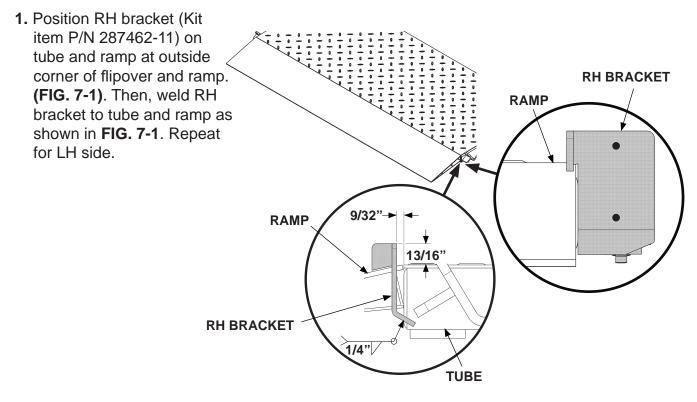



 Allow welds to cool. Then touch up the paint using aluminum primer touchup paint kit, P/N 908134-01 for painted platform. Use cold galvanized spray P/N 908000-01 for galvanized platforms.

# **MAXON**<sup>®</sup> LIFT CORPORATION Sht. 8 of 9 DSG# M-13-06 Rev. A Date: 03/10/14


### KIT P/N 287126-01 (BMR-A WITH STEEL FLIPOVER, FIXED RAMP, SINGLE & DUAL CART STOPS)

## CAUTION

To protect the original paint system, a 3" wide area of paint must be removed from all sides of the weld area before welding.

# **A**WARNING

Welding on galvanized parts gives off especially hazardous fumes. To minimize hazard remove galvanizing from weld area, provide adequate ventilation, and wear suitable respirator.

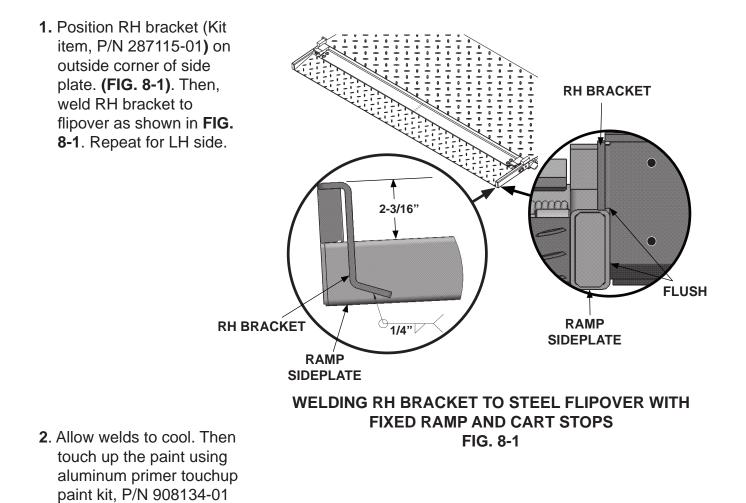


for painted platform. Use cold galvanized spray P/N 908000-01 for galvanized


platforms.

# **MAXON**<sup>®</sup> LIFT CORPORATION Sht. 9 of 9 DSG# M-13-06 Rev. A Date: 03/10/14
 
#### **BOLT LIGHTS TO BRACKETS**


Position flashing light on RH bracket so that LED's and link wire face outward as shown in **FIG. 9-1**. Bolt flashing light to bracket, using button head screws and lock nuts (Kit items). Repeat for LH side.

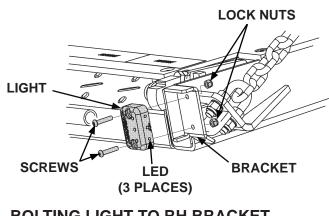



#### **ACTIVATE LIGHTS**


To activate flashing light, cut wire from the center of the link wire as shown in **FIG. 9-2.** 

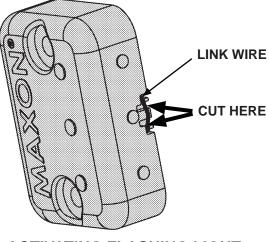

ACTIVATING FLASHING LIGHT FIG. 9-2

#### **RESTORE POWER**

Reconnect battery power to pump by turning **ON** master disconnect switch **(FIG. 9-3)**.

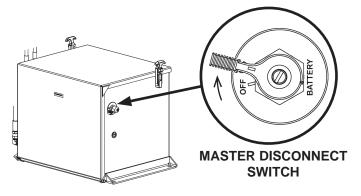

RECONNECTING BATTERY POWER AT PUMP BOX FIG. 9-3